


RB711 workaround for loose MMCX pigtail connection

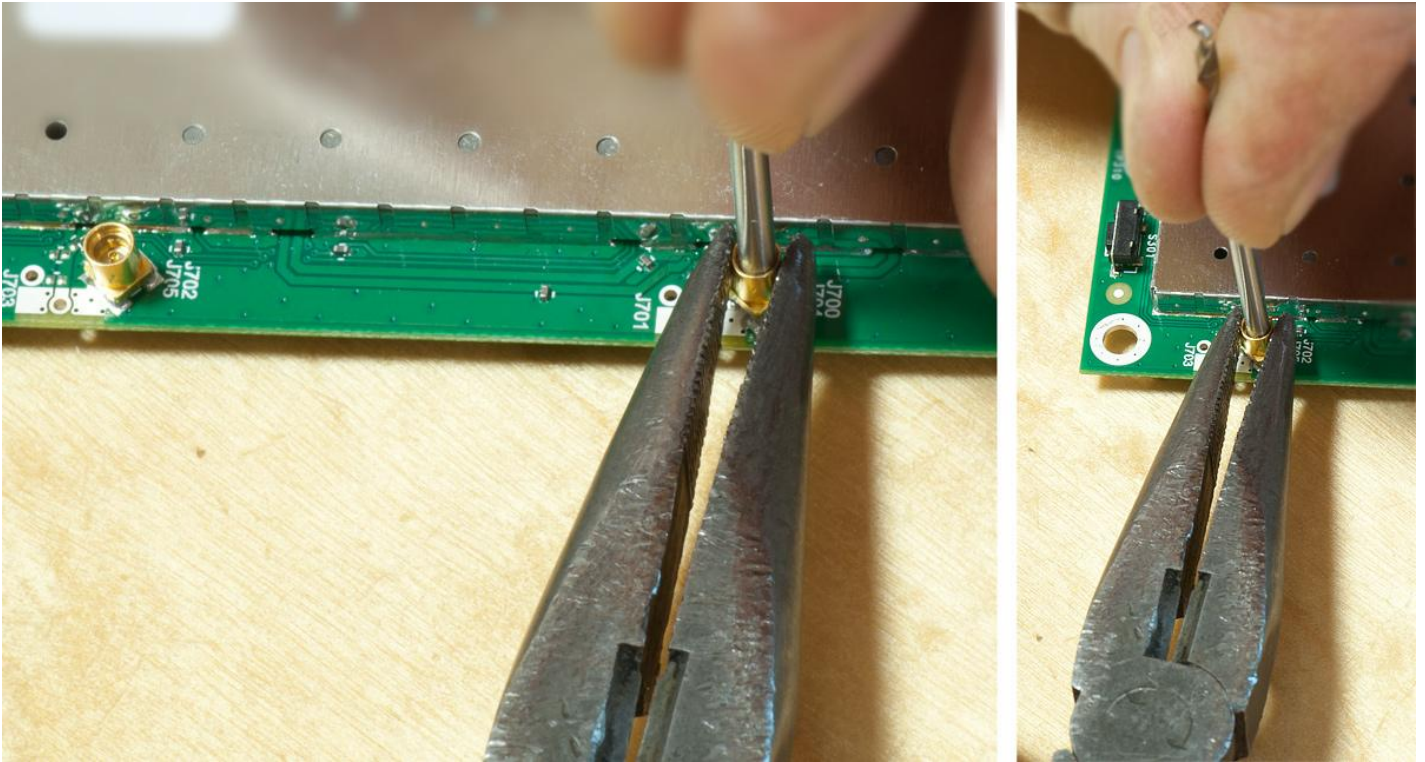

This instruction explains how to fix MMCX connectors on some RB711 devices which show signs of signal loss due to insufficient contact surface in the connector.

Insert the smooth end of a 2.8mm or 7/64" drill bit (or other round and similarly shaped exactly 2.8mm diameter object) into the connector, and squeeze the connector with standard round pliers. This will slightly deform the connector, making pigtail fit tightly. The connector is now ready to use.